SUNSTAR传感与控制 http://www.sensor-ic.com/ TEL:0755-83376549 FAX:0755-83376182 E-MAIL:szss20@163.com

H2S-AH Hydrogen Sulfide Sensor

Technical Specification

Figure 1 H2S-AH Schematic Diagram

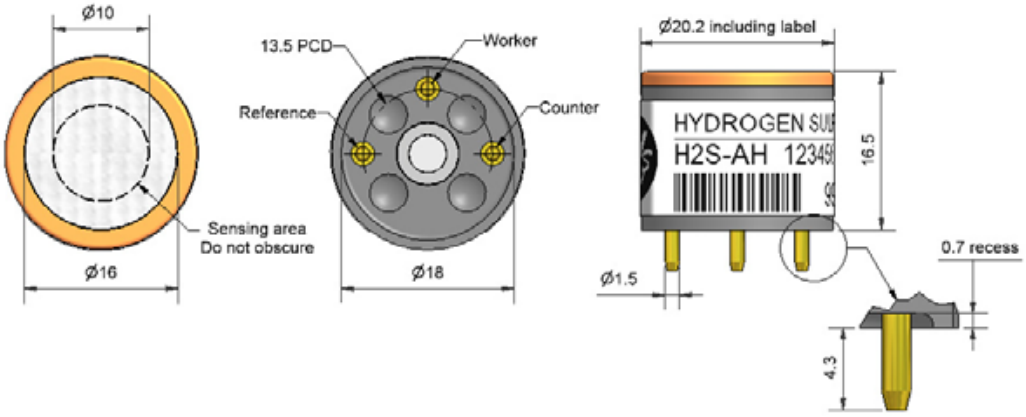

All dimensions in millimetres (± 0.1mm)

Top View **Bottom View** **Side View**

PERFORMANCE	Sensitivity	nA/ppm in 20ppm H_2S		950 to 1400
	Response time	t_{90} (s) from zero to 20ppm H_2S		< 25
	Zero current	ppm equivalent in zero air		< ± 0.15
	Resolution	RMS noise (ppm equivalent)		< 0.05
	Range	ppm H_2S limit of performance warranty		50
	Linearity	ppm error at full scale, linear at zero and 20ppm H_2S		0 to -2.5
	Overgas range	maximum ppm for stable response to gas pulse		250
LIFETIME	Zero drift	ppm equivalent change/year in lab air		< 0.1
	Sensitivity drift	% change/year in lab air, monthly test		< 4
	Operating life	months until 80% original signal (24 month warranted)		> 24
ENVIRONMENTAL	Sensitivity @ -20°C	% (output @ -20°C/output @ 20°C) @ 20ppm		80 to 90
	Sensitivity @ 50°C	% (output @ 50°C/output @ 20°C) @ 20ppm		100 to 111
	Zero @ -20°C	ppm equivalent change from 20°C		< ± 0.3
	Zero @ 50°C	ppm equivalent change from 20°C		< ± 0.15
CROSS SENSITIVITY	SO_2 sensitivity	% measured gas @ 20ppm	SO_2	< 10
	NO sensitivity	% measured gas @ 50ppm	NO	< 2
	NO_2 sensitivity	% measured gas @ 10ppm	NO_2	< -30
	Cl_2 sensitivity	% measured gas @ 10ppm	Cl_2	< -25
	H_2 sensitivity	% measured gas @ 400ppm	H_2	< 0.15
	C_2H_4 sensitivity	% measured gas @ 400ppm	C_2H_4	< 0.15
	CO sensitivity	% measured gas @ 400ppm	CO	< 1.5
	NH_3 sensitivity	% measured gas @ 20ppm	NH_3	< 0.1
KEY SPECIFICATIONS	Temperature range	°C		-30 to 50
	Pressure range	kPa		80 to 120
	Humidity range	% rh continuous		15 to 90
	Storage period	months @ 3 to 20°C (stored in sealed pot)		6
	Weight	g		< 6

NOTE: all sensors are tested at ambient environmental conditions, with 10 ohm load resistor, unless otherwise stated. As applications of use are outside our control, the information provided is given without legal responsibility. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements.

Alphasense Ltd, 3 Oak Industrial Park, Great Dunmow, Essex. CM6 1XN, UK
Telephone: +44 (0) 1371 878048 Fax: +44 (0) 1371 878087 e-mail: sales@alphasense.com Website: www.alphasense.com

SUNSTAR自动化 http://www.sensor-ic.com/ TEL:0755-83376489 FAX:0755-83376182 E-MAIL:szss20@163.com

H2S-AH Performance Data

Technical Specification

Figure 2 Sensitivity Temperature Dependence

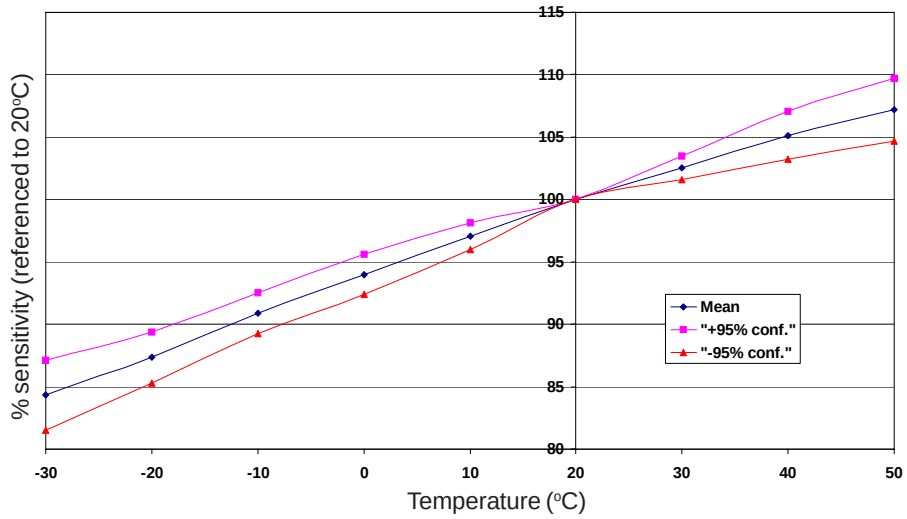

Figure 2 shows the variation in sensitivity caused by changes in temperature.

This data is taken from a typical batch of sensors. The mean and ± 95% confidence intervals are shown.

Figure 3 Zero Temperature Dependence

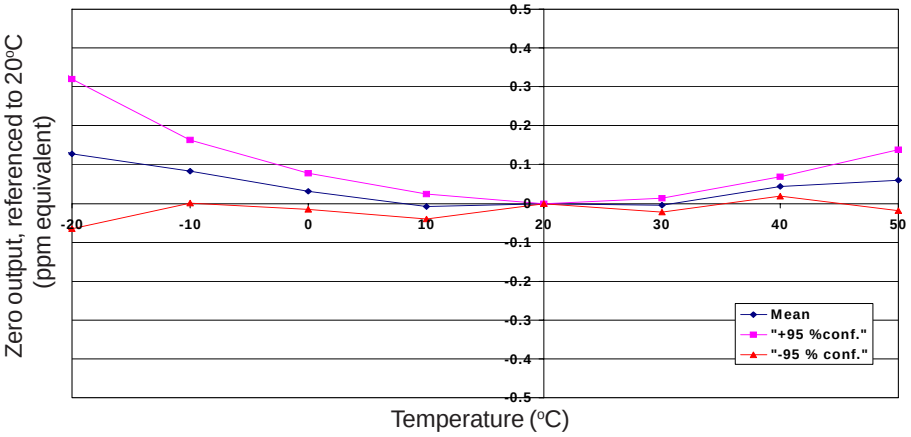

Figure 3 shows the variation in zero output caused by changes in temperature, expressed as ppm gas equivalent.

This data is taken from a typical batch of sensors. The mean and ± 95% confidence intervals are shown.

Figure 4 Sensitivity Long Term Stability

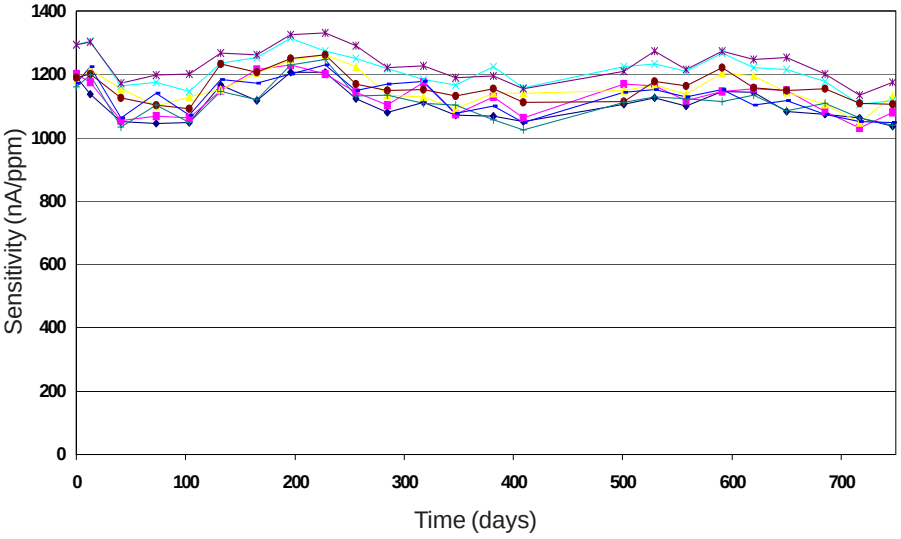

Figure 4 shows the excellent long term stability of the H2S-A1 which results from the combination of a patented design, superior electrochemistry and good process control.

Sensors were stored in extreme humidity/ temperature conditions, simulating real usage.

For further information on the performance of this sensor, on other sensors in the range or any other subject, please contact Alphasense Ltd. For Application Notes visit "www.alphasense.com".

In the interest of continued product improvement, we reserve the right to change design features and specifications without prior notification. The data contained in this document is for guidance only. Alphasense Ltd accepts no liability arising from reliance upon, or use of this document or the information contained within it

(©ALPHASENSE LTD) Doc. Ref. TDS/H2SAH/Issue 12